

< 별첨 1> 측정결과 - 2월 11일 측정 (2월 10일 야간)




문서번호: EC1701539A

- 측정위치 : 인천 문학경기장역
- 현미경 : Leica DM 2500
- 유효여과면적 : 385mm²
- 계수면적 : 0.00785mm²
- 초과여부 : 기준초과(석면비산 측정농도가 1 cc당 0.01 fiber 초과)/
기준미만(석면비산 측정농도가 1 cc당 0.01 fiber 이하)

시료 번호	측정지점	유량(L)	포집시간 (min)	총 시간	측정농도(f/cc)	초과여부
0	공시료	-	-	-	0.000	미만
1	부지경계선	14.3	168	2402.4	0.002	미만
2		14.7	165	2425.5	0.000	미만
3		14.6	166	2423.6	0.001	미만
4		14.4	167	2404.8	0.001	미만
5	위생설비 입구	14.8	28	414.4	0.001	미만
6		14.5	28	406.0	0.001	미만
7	작업장 주변 (실내)	14.9	83	1236.7	0.003	미만
8		14.6	83	1211.8	0.002	미만
9	음압기 배출구	14.3	29	414.7	0.002	미만
10		14.7	28	411.6	0.002	미만
11	폐기물 반출구 (지하1층)	14.8	28	414.4	0.000	미만

< 별첨 2 > 측정 지점 위치 (도식도)

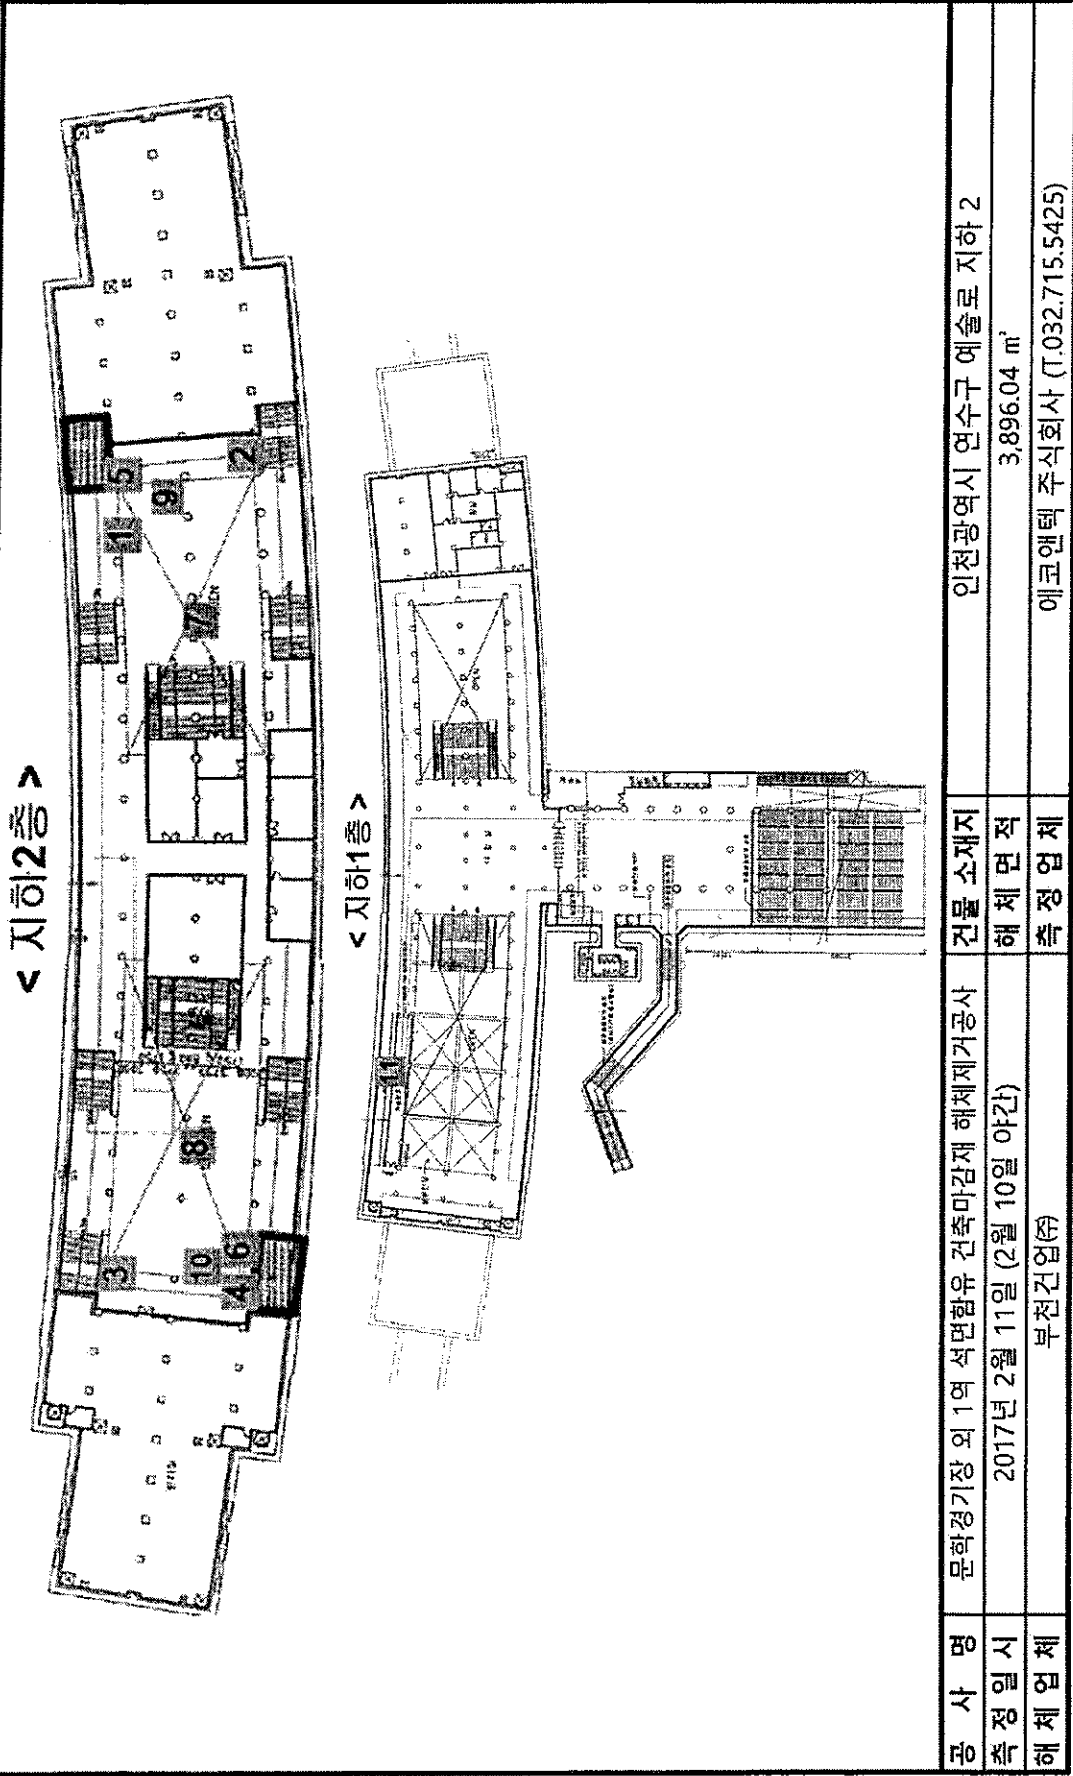

< 별첨 1> 측정결과 - 2월 13일 측정 (2월 12일 야간)



문서번호: EC1701539A

- 측정위치 : 인천 문학경기장역
- 현미경 : Leica DM 2500
- 유효여과면적 : 385mm²
- 계수면적 : 0.00785mm²
- 초과여부 : 기준초과(석면비산 측정농도가 1 cc당 0.01 fiber 초과)/
기준미만(석면비산 측정농도가 1 cc당 0.01 fiber 이하)

시료 번호	측정지점	유량(L)	포집시간 (min)	총 시간	측정농도(f/cc)	초과여부
0	공시료	-	-	-	0.000	미만
1	부지경계선	14.8	165	2442.0	0.001	미만
2		14.3	168	2402.4	0.001	미만
3		14.7	166	2440.2	0.001	미만
4		14.5	167	2421.5	0.001	미만
5	위생설비 입구	14.6	28	408.8	0.001	미만
6		14.4	28	403.2	0.001	미만
7	작업장 주변 (실내)	14.5	83	1203.5	0.002	미만
8		14.8	83	1228.4	0.002	미만
9	음압기 배출구	14.7	28	411.6	0.000	미만
10		14.9	28	417.2	0.000	미만
11	폐기물 반출구 (지하1층)	14.4	29	417.6	0.002	미만




에코앤티텍주식회




< 별첨 2 > 측정 지점 위치 (도식도)

< 지하2층 >

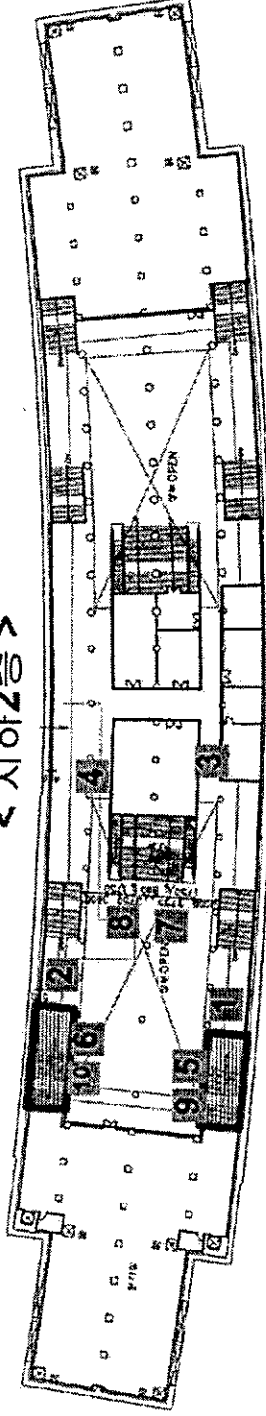

< 지하1층 >

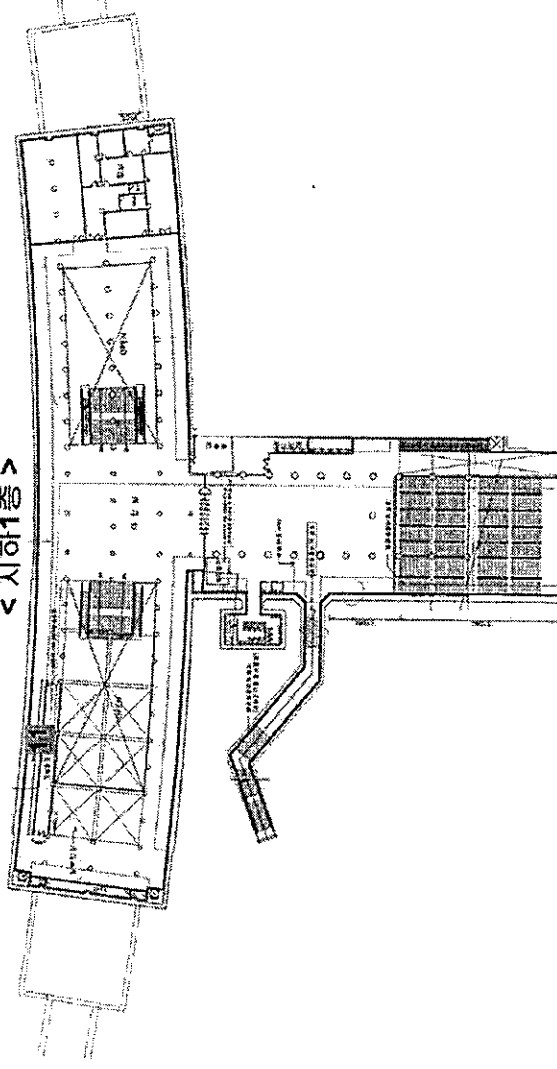

공 사 명	문학경기장 외 1역 석면함유 건축마감재 해체제거공사	건물 소재지	인천광역시 연수구 예술로 지하 2
측 정 일 시	2017년 2월 13일 13일 (2월 12일 야간)	해 체 면 적	3,896.04 m ²
해 체 업체	부천건설(주)	측 정 업체	에코엔텍 주식회사 (T.032.715.5425)

< 별첨 1> 측정결과 - 2월 15일 측정 (2월 14일 야간)



문서번호: EC1701539A

- 측정위치 : 인천 문학경기장역
- 현미경 : Leica DM 2500
- 유효여과면적 : 385mm²
- 계수면적 : 0.00785mm²
- 초과여부 : 기준초과(석면비산 측정농도가 1 cc당 0.01 fiber 초과)/
기준미만(석면비산 측정농도가 1 cc당 0.01 fiber 이하)


시료 번호	측정지점	유량(L)	포집시간 (min)	총 시간	측정농도(f/cc)	초과여부
0	공시료	-	-	-	0.000	미만
1	부지경계선	14.6	165	2409.0	0.002	미만
2		14.5	166	2407.0	0.003	미만
3		14.9	164	2443.6	0.003	미만
4		14.4	167	2404.8	0.002	미만
5	위생설비 입구	14.7	28	411.6	0.001	미만
6		14.3	28	400.4	0.000	미만
7	작업장 주변 (실내)	14.6	83	1211.8	0.002	미만
8		14.5	83	1203.5	0.001	미만
9	음압기 배출구	14.9	27	402.3	0.005	미만
10		14.7	28	411.6	0.005	미만
11	폐기물 반출구 (지하1층)	14.8	29	429.2	0.001	미만



에코앤티텍주식회



< 별첨 2 > 측정 지점 위치 (도식도)

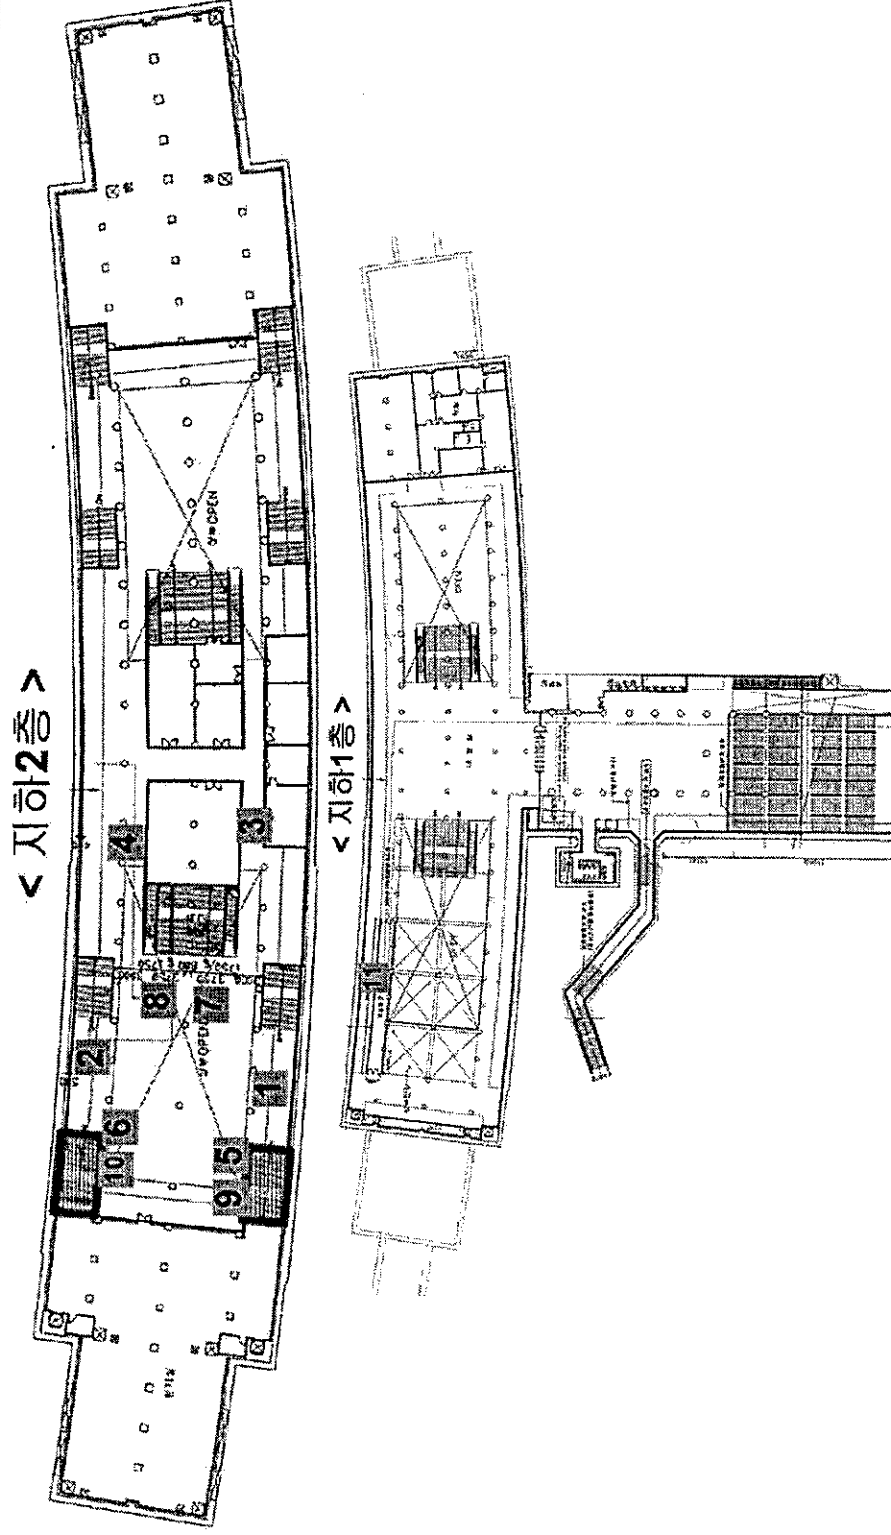

공사 명	문학경기장 외 1역 석면함유 건축마감재 해체제거공사	건물 소재지	인천광역시 연수구 예술로 지하 2
측정일시	2017년 2월 15일 (2월 14일 야간)	해체 면적	3,896.04 m ²
해체업체	부천건업㈜	측정업체	에코앤티크 주식회사 (T.032.715.5425)

< 별첨 1> 측정결과 - 2월 16일 측정 (2월 15일 야간)




문서번호: EC1701539A

- 측정위치 : 인천 문학경기장역
- 현미경 : Leica DM 2500
- 유효여과면적 : 385mm²
- 계수면적 : 0.00785mm²
- 초과여부 : 기준초과(석면비산 측정농도가 1 cc당 0.01 fiber 초과)/
기준미만(석면비산 측정농도가 1 cc당 0.01 fiber 이하)


시료 번호	측정지점	유량(L)	포집시간 (min)	총 시간	측정농도(f/cc)	초과여부
0	공시료	-	-	-	0.000	미만
1	부지경계선	14.9	164	2443.6	0.003	미만
2		14.7	165	2425.5	0.003	미만
3		14.3	168	2402.4	0.002	미만
4		14.5	167	2421.5	0.002	미만
5	위생설비 입구	14.6	28	408.8	0.003	미만
6		14.4	29	417.6	0.002	미만
7	작업장 주변 (실내)	14.8	83	1228.4	0.004	미만
8		14.4	84	1209.6	0.003	미만
9	음압기 배출구	14.4	28	403.2	0.007	미만
10		14.9	27	402.3	0.006	미만
11	폐기물 반출구 (지하1층)	14.5	28	406.0	0.001	미만

< 별첨 2 > 측정 지점 위치 (도식도)

< 지하2층 >

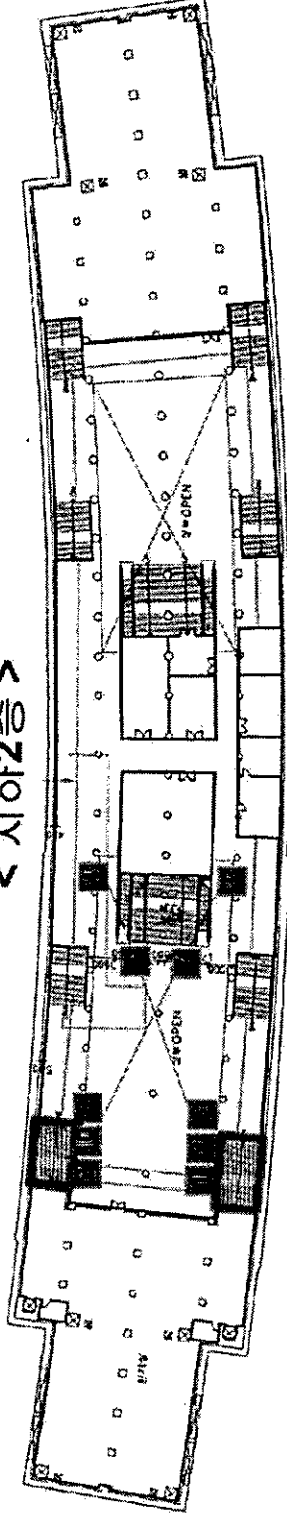

< 지하1층 >

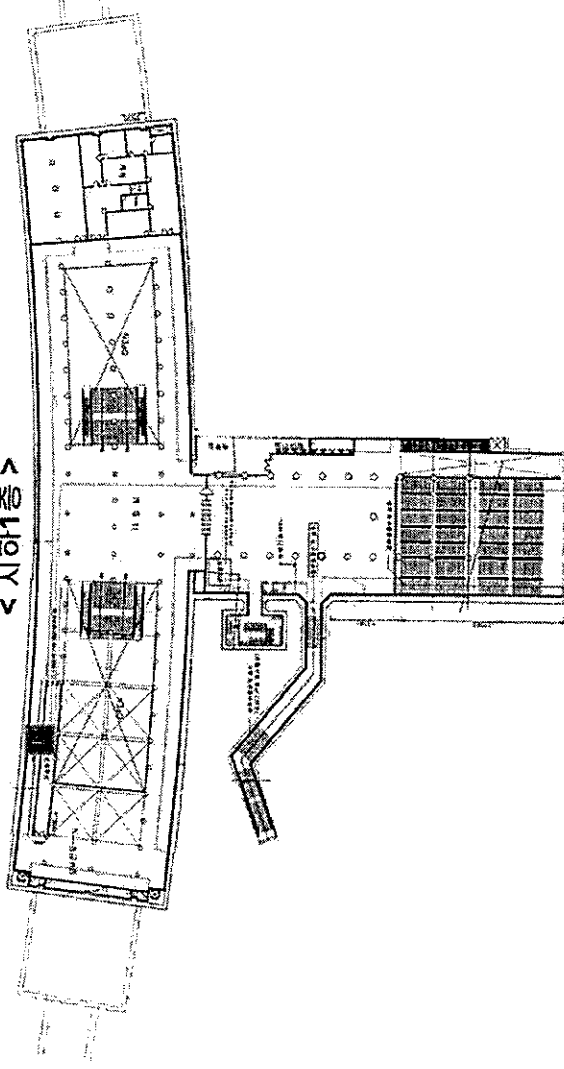

공사 명	문학경기장 외 1역 석면함유 건축마감재 해체제거공사	건물 소재지	인천광역시 연수구 예술로 지하 2
측정 일시	2017년 2월 16일 (2월 15일 야간)	해체 면적	3,896.04 m ²
해체 업체	부천건설(주)	측정 업체	에코엔텍 주식회사 (T.032.715.5425)

< 별첨 1> 측정결과 - 2월 17일 측정 (2월 16일 야간)



문서번호: EC1701539A

- 측정위치 : 인천 문학경기장역
- 현미경 : Leica DM 2500
- 유효여과면적 : 385mm²
- 계수면적 : 0.00785mm²
- 초과여부 : 기준초과(석면비산 측정농도가 1 cc당 0.01 fiber 초과)/
기준미만(석면비산 측정농도가 1 cc당 0.01 fiber 이하)


시료 번호	측정지점	유량(L)	포집시간 (min)	총 시간	측정농도(f/cc)	초과여부
0	공시료	-	-	-	0.000	미만
1	부지경계선	14.5	166	2407.0	0.004	미만
2		14.4	167	2404.8	0.003	미만
3		14.7	165	2425.5	0.004	미만
4		14.6	165	2409.0	0.005	미만
5	위생설비 입구	14.8	28	414.4	0.002	미만
6	작업장 주변 (실내)	14.3	84	1201.2	0.004	미만
7		14.9	83	1236.7	0.006	미만
8	음압기 배출구	14.5	28	406.0	0.002	미만
9	폐기물 반출구 (지하1층)	14.4	29	417.6	0.001	미만




에코앤티텍주식회




< 별첨 2 > 측정 지점 위치 (도식도)

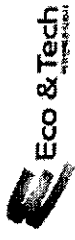

< 지하2층 >

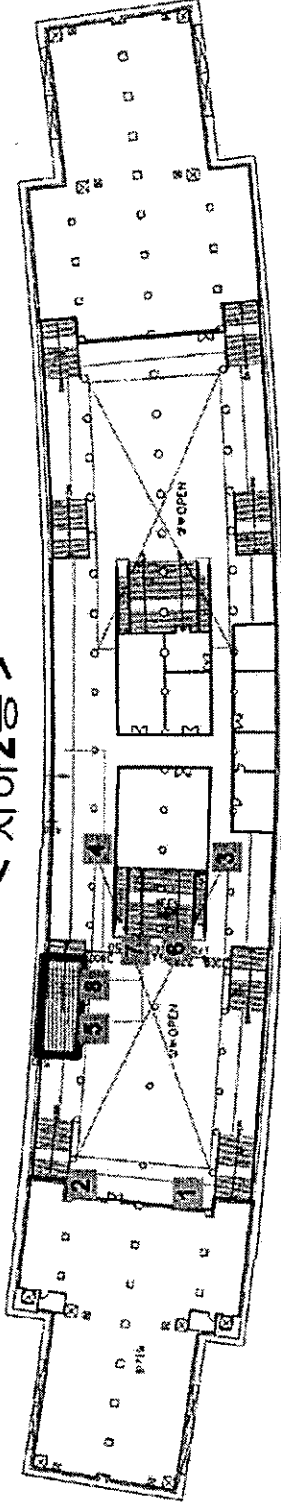

< 지하1층 >

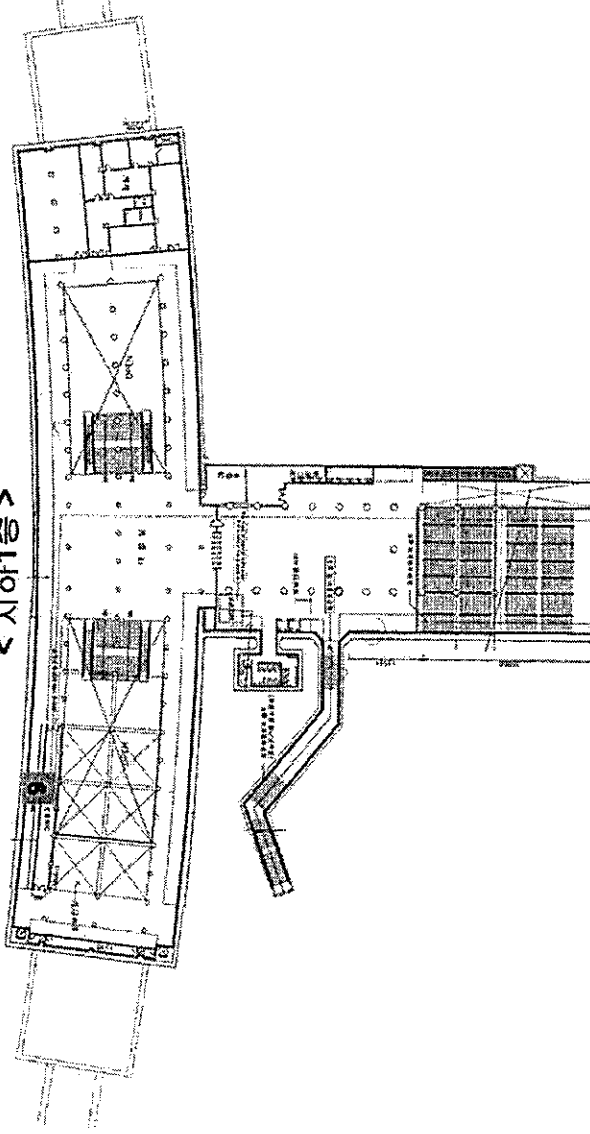

공 사 명	문화경기장 외 1역 석면함유 건축마감재 해체제거공사	건물 소재지	인천광역시 연수구 예술로 지하 2
측 정 일 시	2017년 2월 17일 (2월 16일 야간)	해 체 면 적	3,896.04 m ²
해 체 업 체	부천건설(주)	측 정 업 체	에코앤티크 주식회사 (T.032.715.5425)

< 별첨 1> 측정결과 - 2월 18일 측정 (2월 17일 야간)



문서번호: EC1701539A

- 측정위치 : 인천 문학경기장역
- 현미경 : Leica DM 2500
- 유효여과면적 : 385mm²
- 계수면적 : 0.00785mm²
- 초과여부 : 기준초과(석면비산 측정농도가 1 cc당 0.01 fiber 초과)/
기준미만(석면비산 측정농도가 1 cc당 0.01 fiber 이하)

시료 번호	측정지점	유량(L)	포집시간 (min)	총 시간	측정농도(f/cc)	초과여부
0	공시료	-	-	-	0.000	미만
1	부지경계선	14.6	165	2409.0	0.004	미만
2		14.8	164	2427.2	0.003	미만
3		14.5	166	2407.0	0.004	미만
4		14.9	164	2443.6	0.003	미만
5	위생설비 입구	14.7	28	411.6	0.003	미만
6		14.5	28	406.0	0.002	미만
7	작업장 주변 (실내)	14.4	84	1209.6	0.003	미만
8		14.3	85	1215.5	0.004	미만
9	음압기 배출구	14.6	28	408.8	0.003	미만
10		14.7	28	411.6	0.003	미만
11	폐기물 반출구 (지하1층)	14.8	29	429.2	0.000	미만




에코앤티텍주식회




< 별첨 2 > 측정 지점 위치 (도식도)



< 지하2층 >

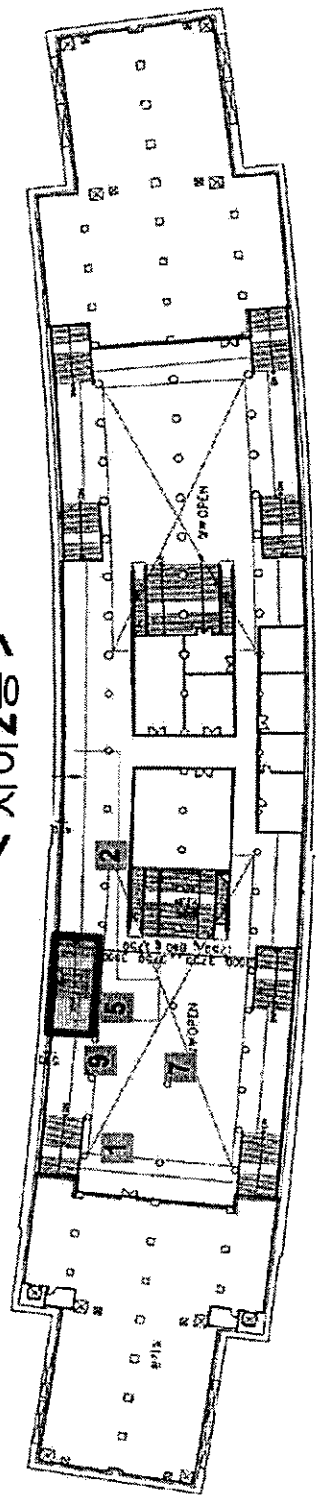


< 지하3층 >

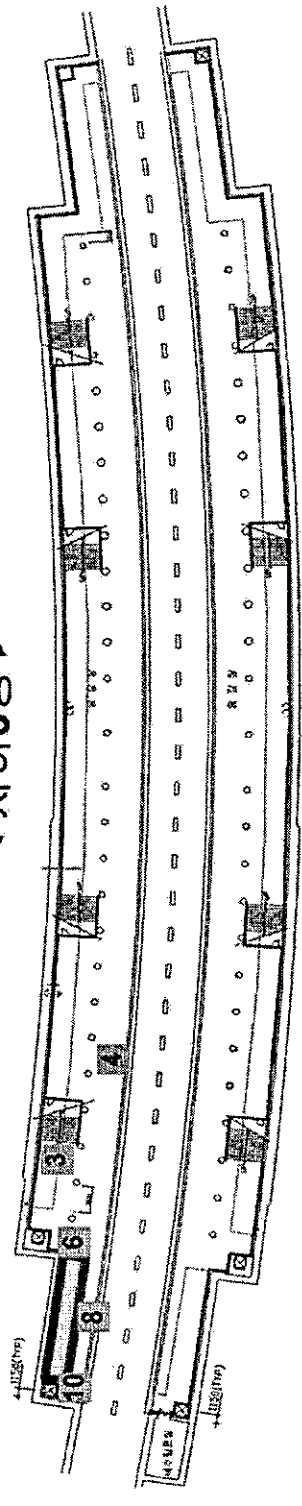

공 사 명	문화경기장 외 1역 석면함유 건축 마감재 해체제거공사	건물 소재지	인천광역시 연수구 예술로 지하 2
측 정 일 시	2017년 2월 18일 (2월 17일 야간)	해 체 면 적	3,896.04 m ²
해 체 업 체	부천건설(주)	측 정 업 체	에코앤티크 주식회사 (T.032.715.5425)


< 별첨 2 > 측정 지점 위치 (도식도)

< 지하1층 >

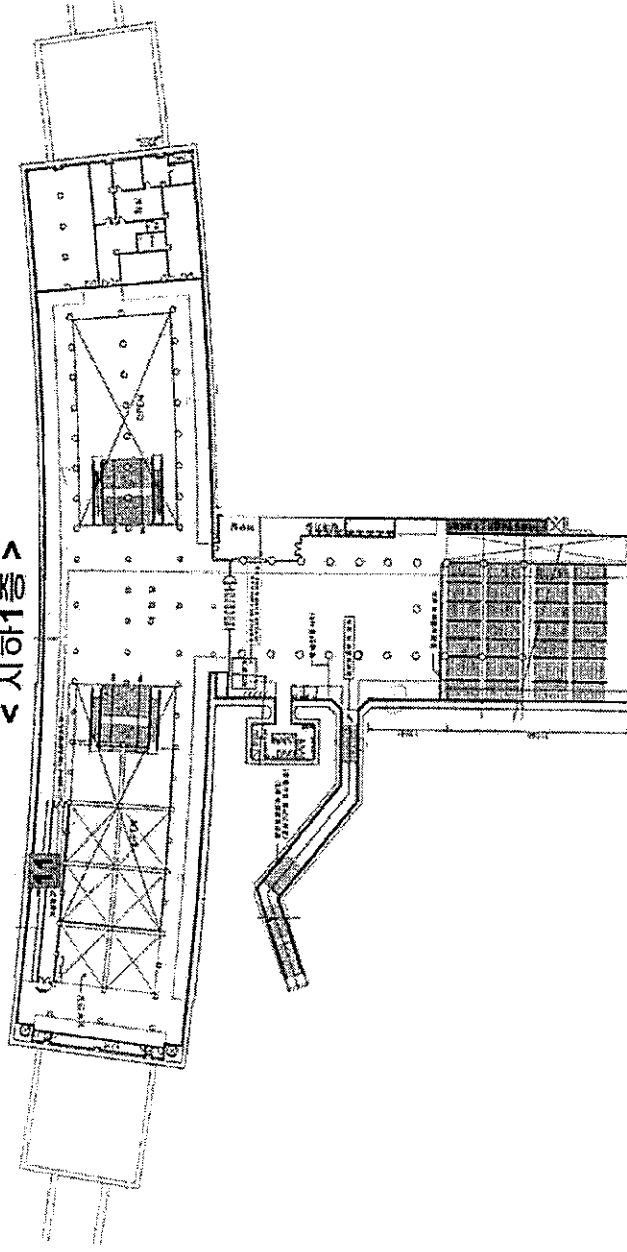

공 사 명	문화경기장 외 1역 석면할유 건축마감제 해체제거공사	건물 소재지	인천광역시 연수구 예술로 지하 2
측 정 일 시	2017년 2월 18일 (2월 17일 야간)	해 체 면 적	3,896.04 m ²
해 체 업 체	부천건설(주)	측 정 업 체	에코앤티크 주식회사 (T.032.715.5425)

< 별첨 1> 측정결과 - 2월 20일 측정 (2월 19일 야간)

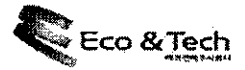

문서번호: EC1701539A

- 측정위치 : 인천 문학경기장역
- 현미경 : Leica DM 2500
- 유효여과면적 : 385mm²
- 계수면적 : 0.00785mm²
- 초과여부 : 기준초과(석면비산 측정농도가 1 cc당 0.01 fiber 초과)/
기준미만(석면비산 측정농도가 1 cc당 0.01 fiber 이하)

시료 번호	측정지점	유량(L)	포집시간 (min)	총 시간	측정농도(f/cc)	초과여부
0	공시료	-	-	-	0.000	미만
1	부지경계선	14.7	165	2425.5	0.001	미만
2		14.5	166	2407.0	0.001	미만
3		14.4	167	2404.8	0.001	미만
4		14.9	164	2443.6	0.000	미만
5	위생설비 입구	14.6	28	408.8	0.001	미만
6		14.3	29	414.7	0.002	미만
7	작업장 주변 (실내)	14.8	82	1213.6	0.002	미만
8		14.5	83	1203.5	0.002	미만
9	음압기 배출구	14.2	29	411.8	0.000	미만
10		14.6	29	423.4	0.001	미만
11	폐기물 반출구 (지하1층)	14.8	28	414.4	0.000	미만



에코앤티텍주식회




This architectural drawing shows a long, narrow building with a central corridor. The building is divided into several rooms, each with a door and a window. The rooms are numbered 1 through 10. The central corridor is marked with a dashed line. The drawing is oriented vertically, with the entrance at the top. The rooms are arranged in a row, with the central corridor running through the middle. The drawing is a black and white line drawing, showing the layout of the building and the placement of doors and windows.

공 사 명	문학경기장과 1역 석면함유 건축마감재 해체제거공사	건물 소재지	인천광역시 연수구 예술로 지하 2
축 정 일 시	2017년 2월 20일 (2월 19일 아간)	해 체 면 적	3,896.04 m ²
해 체 업체	부천건임(주)	측 정 업체	에코엔텍 주식회사 (T.032715.5425)

< 별첨 2 > 측정 지점 위치 (도식도)

< 지하1층 >

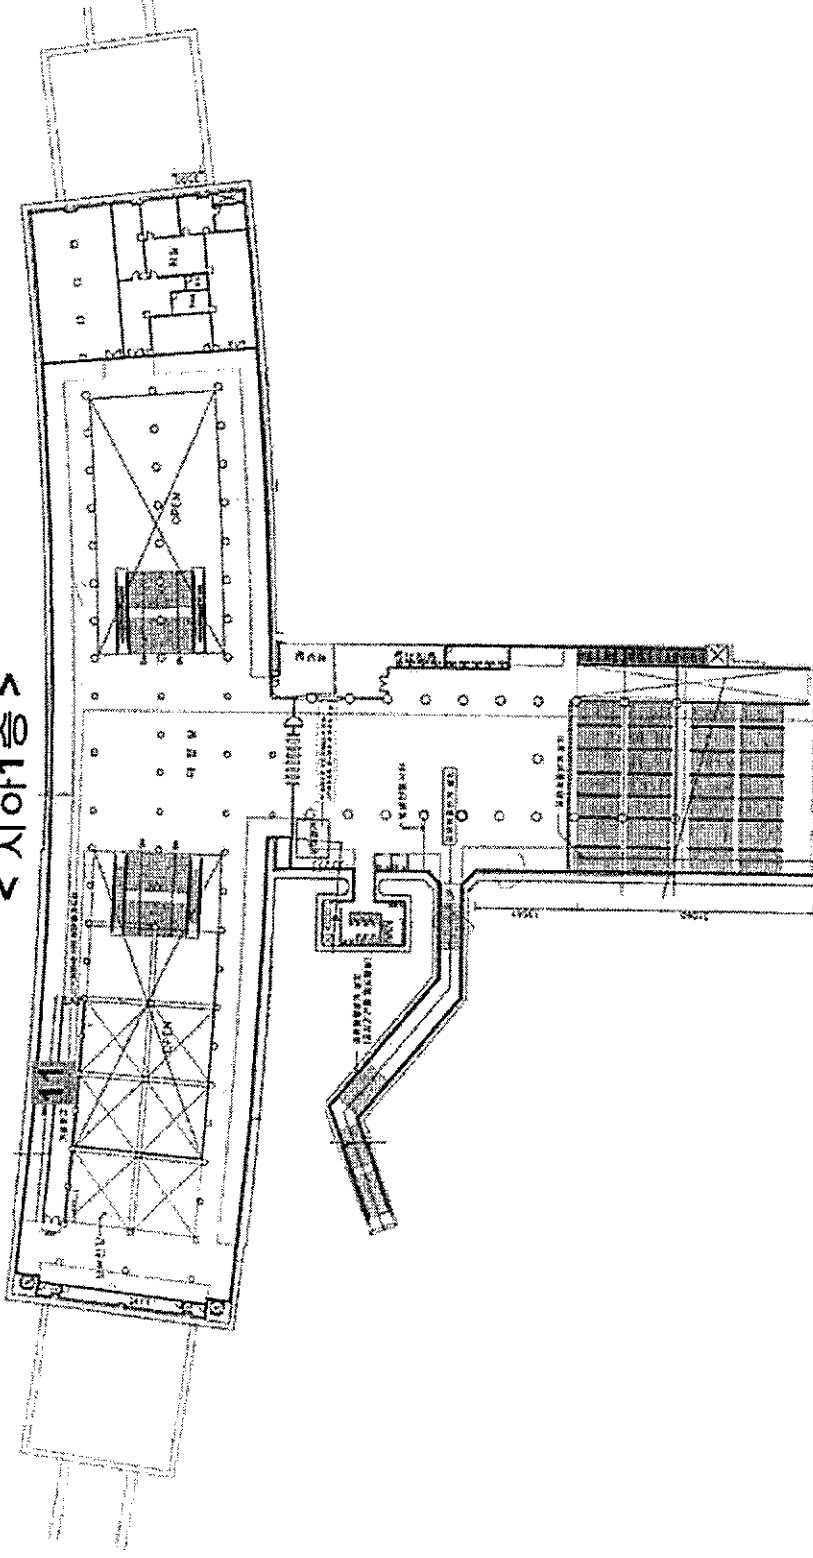

공 사 명	문학경기장 외 1역 석면함유 건축마감재 해체제거공사	건물 소재지	인천광역시 연수구 예술로 지하 2
측 정 일 시	2017년 2월 20일 (2월 19일 야간)	해 체 면 적	3,896.04 m ²
해 체 업 체	부천건설㈜	측 정 업 체	에코앤티크 주식회사 (T.032.715.5425)