

< 별첨 1> 측정결과 - 3월 11일 측정 (3월 10일 야간)



문서번호: EC1701539A

- 측정위치 : 인천 문학경기장역
- 현미경 : Leica DM 2500
- 유효여과면적 : 385mm²
- 계수면적 : 0.00785mm²
- 초과여부 : 기준초과(석면비산 측정농도가 1 cc당 0.01 fiber 초과)/
기준미만(석면비산 측정농도가 1 cc당 0.01 fiber 이하)


시료 번호	측정지점	유량(L)	포집시간 (min)	총 시간	측정농도(f/cc)	초과여부
0	공시료	-	-	-	0.000	미만
1	부지경계선	14.9	165	2458.5	0.006	미만
2		14.6	166	2423.6	0.004	미만
3		14.7	166	2440.2	0.003	미만
4		14.8	165	2442.0	0.003	미만
5	위생설비 입구	14.5	28	406.0	0.002	미만
8		14.4	28	403.2	0.003	미만
11		14.6	29	423.4	0.003	미만
7	작업장 주변 (실내)	14.8	83	1228.4	0.002	미만
10		14.7	82	1205.4	0.006	미만
13		14.9	82	1221.8	0.007	미만
6	음압기 배출구	14.5	29	420.5	0.004	미만
9		14.4	29	417.6	0.006	미만
12		14.4	29	417.6	0.004	미만
14	폐기물 반출구 (지하1층)	14.6	28	408.8	0.001	미만



에코앤티텍주식회



< 별첨 2 > 축정 지정 위치 (도식도)

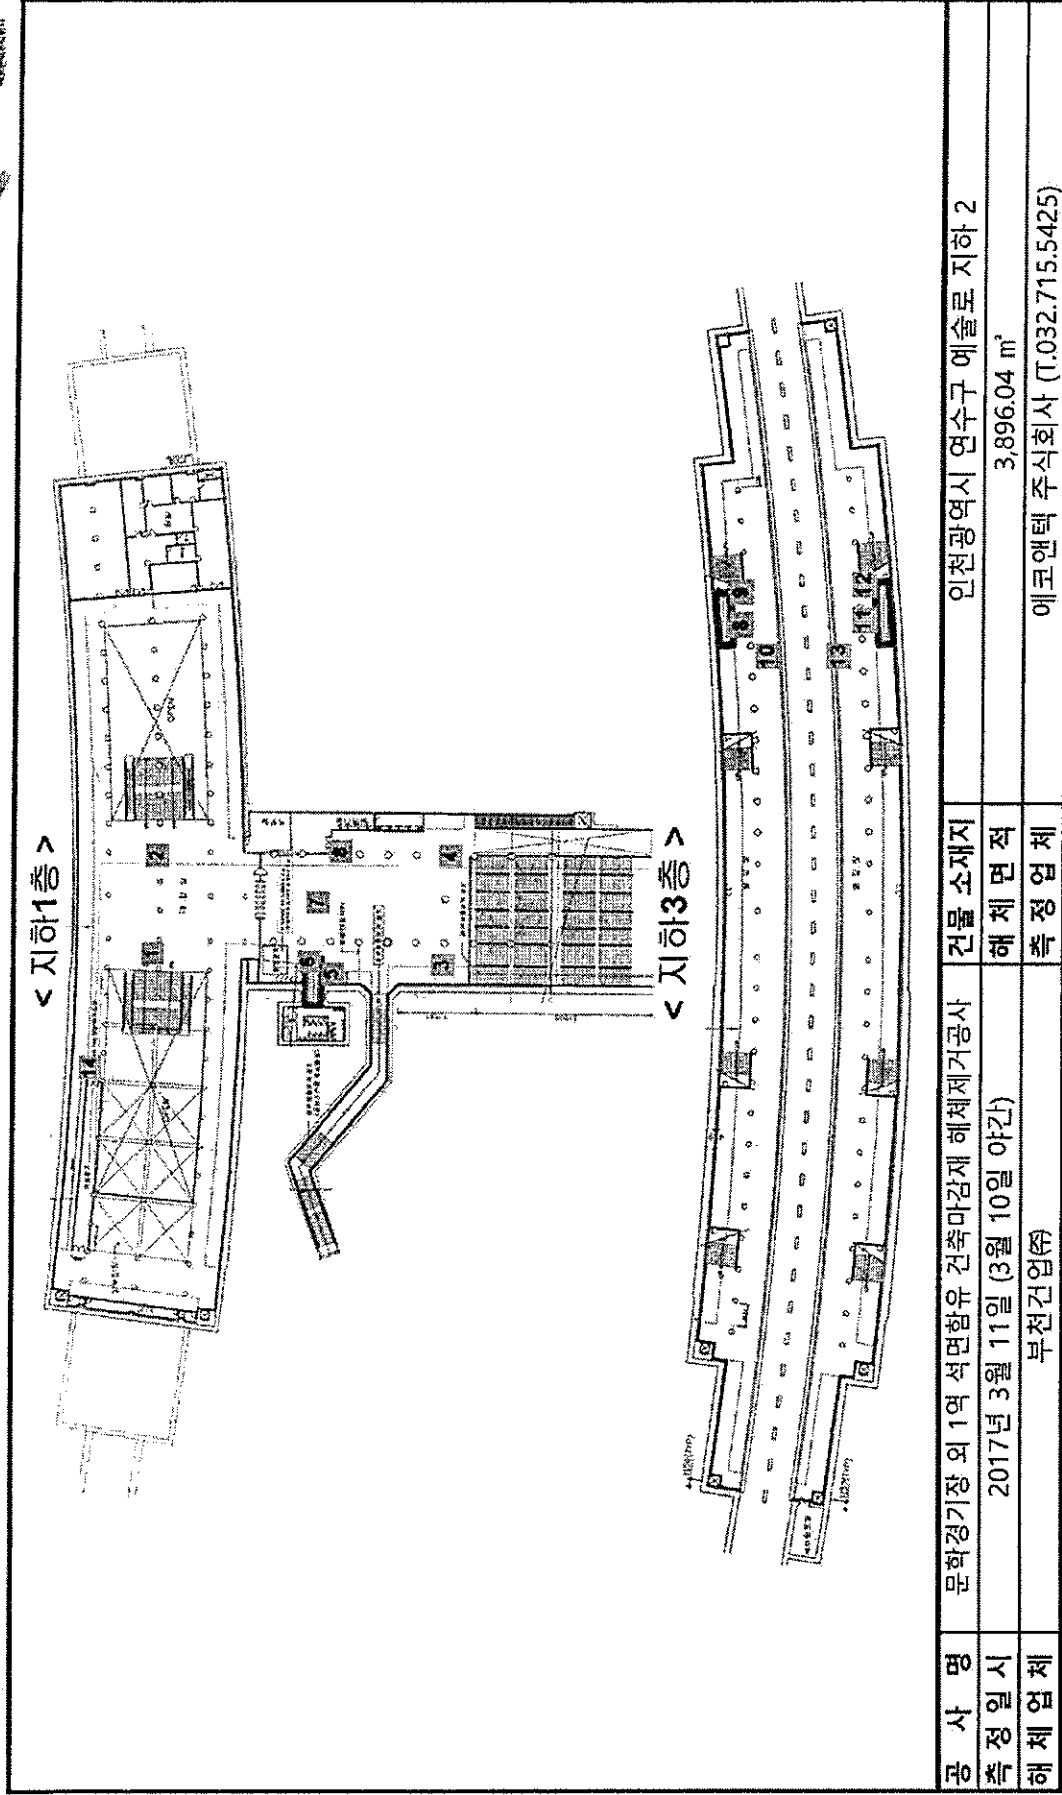

공 사 명	문학경기장 외 1역 석면함유 건축마감재 해체제거공사	건물 소재지	인천광역시 연수구 예술로 지하 2
축 정 일 시	2017년 3월 11일 (3월 10일 야간)	해 체 면 적	3,896.04 m ²
해 체 업 체	부천건설㈜	축 정 업 체	에코앤티크 주식회사 (T.032.715.5425)

< 별첨 1> 측정결과 - 3월 14일 측정 (3월 13일 야간)



문서번호: EC1701539A

- 측정위치 : 인천 문학경기장역
- 현미경 : Leica DM 2500
- 유효여과면적 : 385mm²
- 계수면적 : 0.00785mm²
- 초과여부 : 기준초과(석면비산 측정농도가 1 cc당 0.01 fiber 초과)/
기준미만(석면비산 측정농도가 1 cc당 0.01 fiber 이하)


시료 번호	측정지점	유량(L)	포집시간 (min)	총 시간	측정농도(f/cc)	초과여부
0	공시료	-	-	-	0.000	미만
1	부지경계선	14.8	165	2442.0	0.001	미만
2		14.5	166	2407.0	0.002	미만
3		14.9	165	2458.5	0.002	미만
4		14.4	167	2404.8	0.001	미만
5	위생설비 입구	14.6	28	408.8	0.001	미만
7	작업장 주변 (실내)	14.7	82	1205.4	0.002	미만
8		14.8	82	1213.6	0.002	미만
6	음압기 배출구	14.9	27	402.3	0.001	미만
9	폐기물 반출구	14.5	28	406.0	0.000	미만



에코앤티텍주식회



< 별첨 2 > 측정 지점 위치 (도식도)

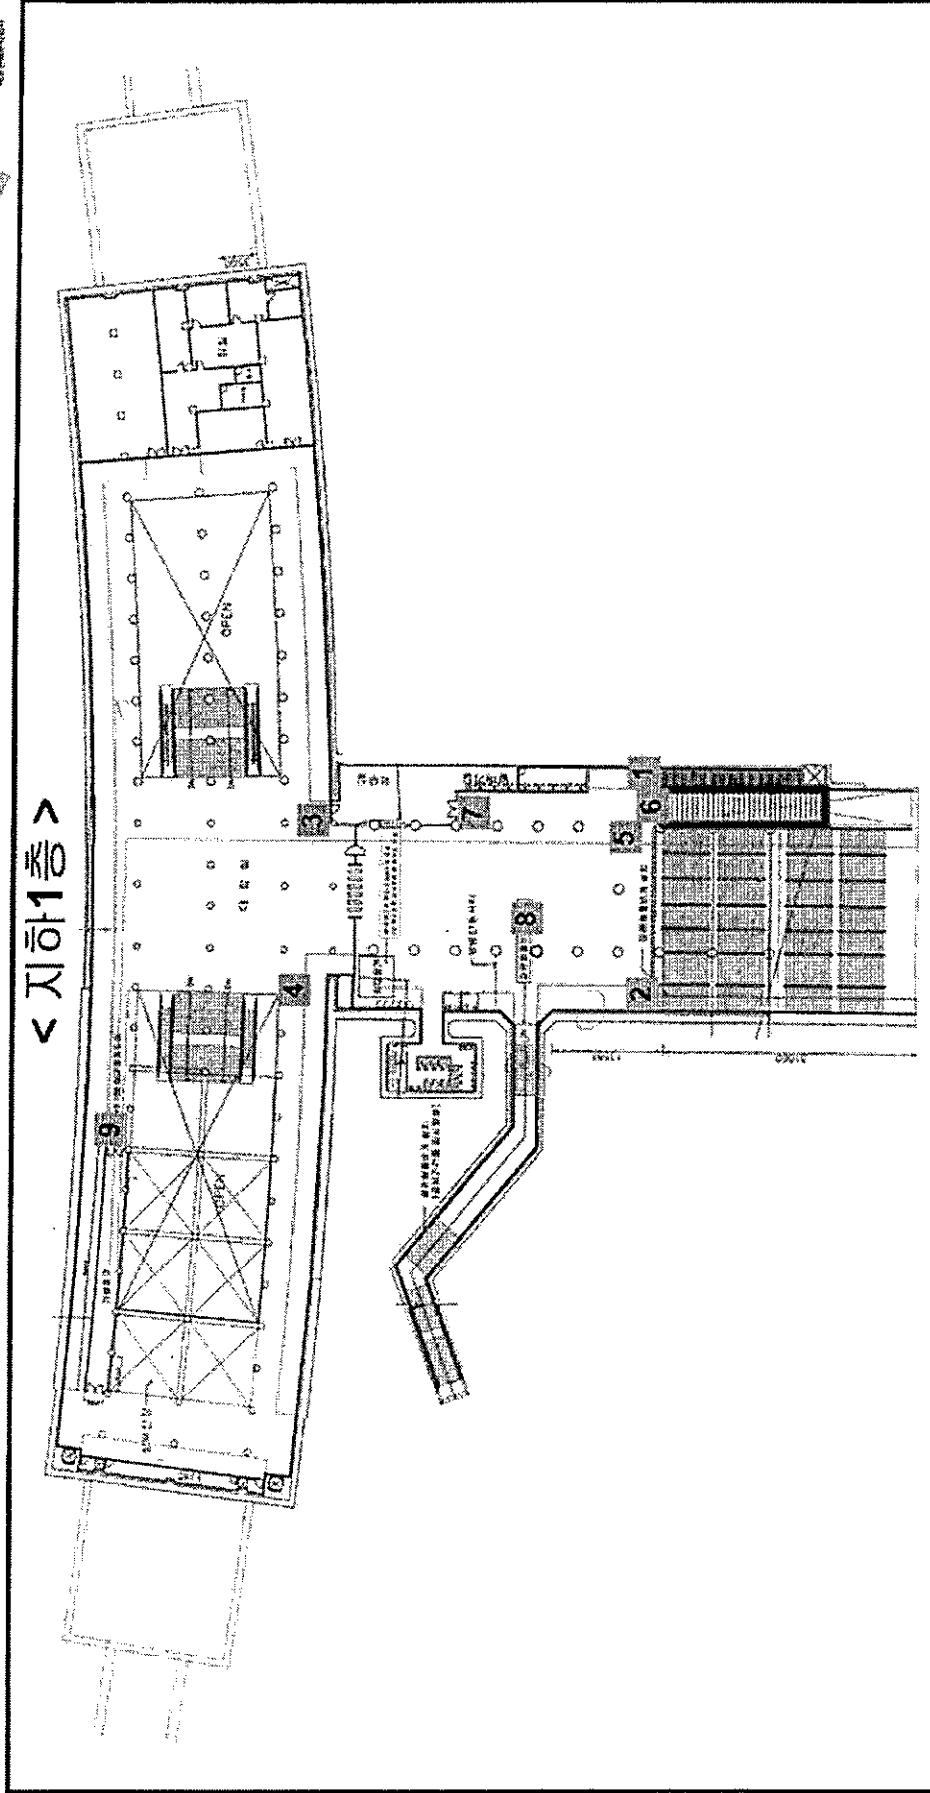

공 사 명	문학경기장 외 1역 석면함유 건축마감재 해체제거공사	건물 소재지	인천광역시 연수구 예술로 지하 2
측정 일시	2017년 3월 14일 (3월 13일 야간)	해 체 면 적	3,896.04 m ²
해 체 업 체	부천건설(주)	측 정 업 체	에코엔텍 주식회사 (T.032.715.5425)

< 별첨 1> 측정결과 - 3월 15일 측정 (3월 14일 야간)



문서번호: EC1701539A

- 측정위치 : 인천 문학경기장역
- 현미경 : Leica DM 2500
- 유효여과면적 : 385mm²
- 계수면적 : 0.00785mm²
- 초과여부 : 기준초과(석면비산 측정농도가 1 cc당 0.01 fiber 초과)/
기준미만(석면비산 측정농도가 1 cc당 0.01 fiber 이하)

시료 번호	측정지점	유량(L)	포집시간 (min)	총 시간	측정농도(f/cc)	초과여부
0	공시료	-	-	-	0.000	미만
1	부지경계선	14.9	164	2443.6	0.002	미만
2		14.8	165	2442.0	0.002	미만
3		14.6	165	2409.0	0.001	미만
4		14.7	164	2410.8	0.001	미만
5	위생설비 입구	14.5	28	406.0	0.002	미만
7	작업장 주변 (실내)	14.7	83	1220.1	0.001	미만
8		14.6	83	1211.8	0.001	미만
6	음압기 배출구	14.5	28	406.0	0.002	미만
9	폐기물 반출구	14.8	28	414.4	0.000	미만



에코앤티텍주식회



This architectural floor plan depicts a complex building layout. The plan includes several large rectangular rooms, some of which are divided into smaller sections. A prominent feature is a large room on the left side, which is divided into a grid of smaller spaces. To the right of this room is a large, open area. Further to the right, there is a long, narrow room with a series of small, rectangular units or stalls. The plan also shows various corridors, doorways, and structural elements like walls and columns. The drawing is a black and white line drawing, typical of architectural blueprints. The text 'シオリア' is visible on the left side of the plan.

공 사 명	문화경기장 외 1역 석면함유 건축마감재 해체제거공사	건물 소재지	인천광역시 연수구 예술로 지하 2
추정일시	2017년 3월 15일 (3월 14일 야간)	해체 면적	3,896.04 m²
해체업체	부천건설(주)	추정업체	에코엔텍 주식회사 (T.032.715.5425)

< 별첨 1> 측정결과 - 3월 16일 측정 (3월 15일 야간)



문서번호: EC1701539A

- 측정위치 : 인천 문학경기장역
- 현미경 : Leica DM 2500
- 유효여과면적 : 385mm²
- 계수면적 : 0.00785mm²
- 초과여부 : 기준초과(석면비산 측정농도가 1 cc당 0.01 fiber 초과)/
기준미만(석면비산 측정농도가 1 cc당 0.01 fiber 이하)

시료 번호	측정지점	유량(L)	포집시간 (min)	총 시간	측정농도(f/cc)	초과여부
0	공시료	-	-	-	0.000	미만
1	부지경계선	14.8	165	2442.0	0.001	미만
2		14.5	166	2407.0	0.001	미만
3		14.7	165	2425.5	0.001	미만
4		14.6	166	2423.6	0.000	미만
5	위생설비 입구	14.3	29	414.7	0.002	미만
6	음압기 배출구	14.4	28	403.2	0.003	미만
7	작업장 주변 (실내)	14.9	82	1221.8	0.003	미만
8		14.5	83	1203.5	0.004	미만
9	폐기물 반출구	14.8	28	414.4	0.000	미만




에코앤티텍주식회



< 별첨 2 > 측정 지점 위치 (도식도)




< 지하1층 >

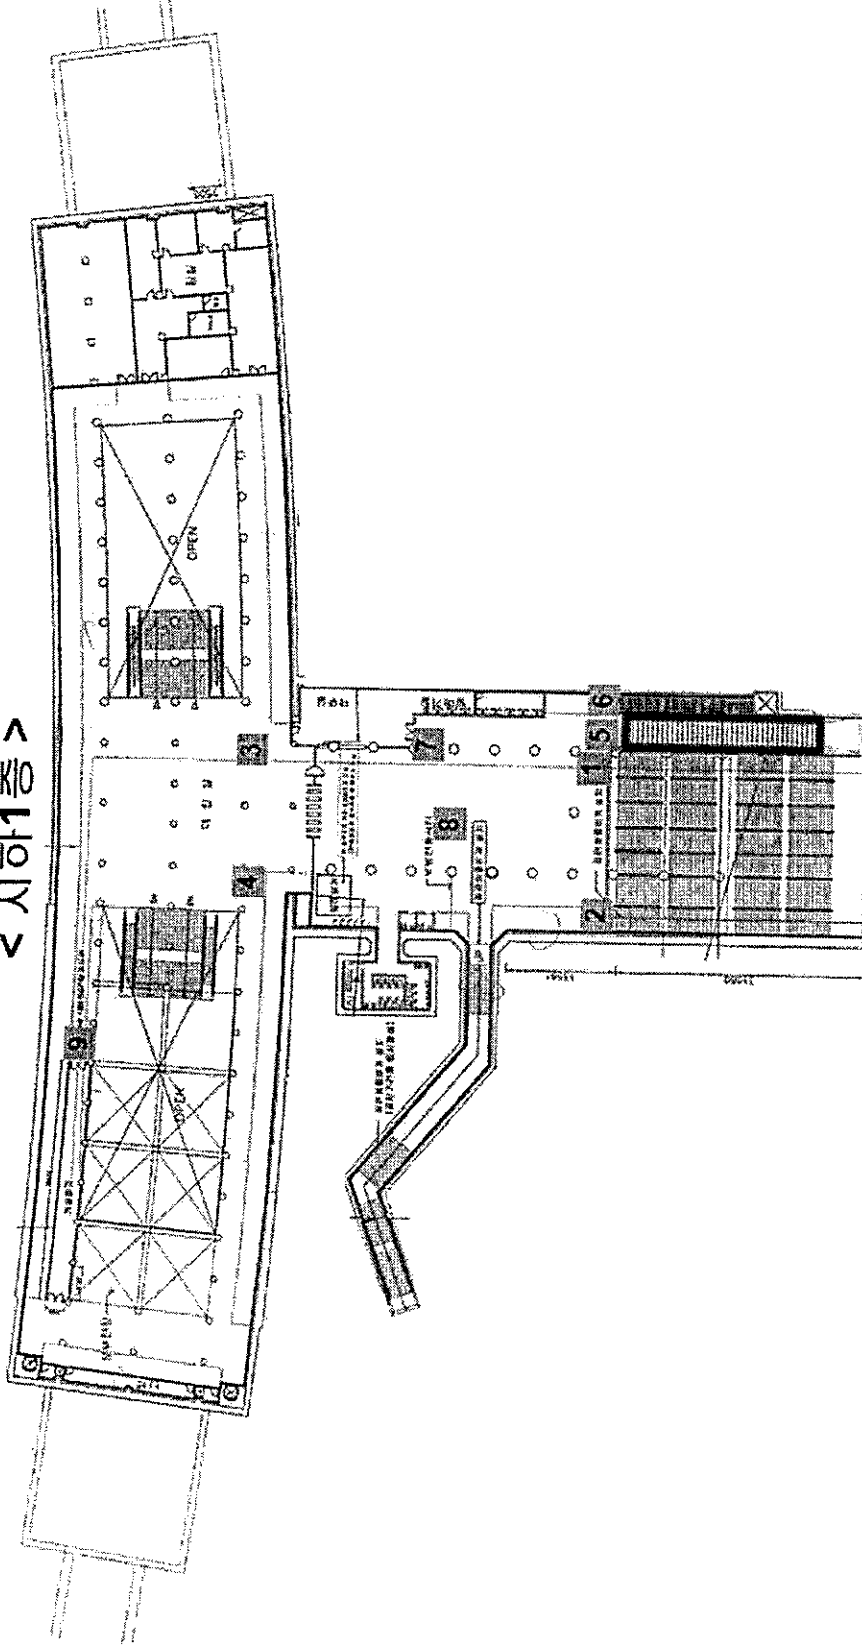

공 사 명	문학경기장 외 1역 석면함유 건축마감재 해체제거공사	건물 소재지	인천광역시 연수구 예술로 지하 2
측 정 일 시	2017년 3월 16일 (3월 15일 야간)	해 체 면 적	3,896.04 m ²
해 체 업 체	부천건설㈜	측 정 업 체	에코엔텍 주식회사 (T.032.715.5425)

< 별첨 1> 측정결과 - 3월 17일 측정 (3월 16일 야간)



문서번호: EC1701539A

- 측정위치 : 인천 문학경기장역
- 현미경 : Leica DM 2500
- 유효여과면적 : 385mm²
- 계수면적 : 0.00785mm²
- 초과여부 : 기준초과(석면비산 측정농도가 1 cc당 0.01 fiber 초과)/
기준미만(석면비산 측정농도가 1 cc당 0.01 fiber 이하)

시료 번호	측정지점	유량(L)	포집시간 (min)	총 시간	측정농도(f/cc)	초과여부
0	공시료	-	-	-	0.000	미만
1	부지경계선	14.6	166	2423.6	0.002	미만
2		14.4	167	2404.8	0.001	미만
3		14.9	165	2458.5	0.001	미만
4		14.7	166	2440.2	0.001	미만
5	위생설비 입구	14.3	29	414.7	0.001	미만
6	음압기 배출구	14.5	28	406.0	0.002	미만
7	작업장 주변 (실내)	14.8	83	1228.4	0.001	미만
8		14.4	84	1209.6	0.001	미만
9	폐기물 반출구	14.9	27	402.3	0.000	미만



에코앤티텍주식회



This is a detailed architectural floor plan of a building. The plan shows a complex layout of rooms, corridors, and structural elements. Key features include:

- Rooms and Spaces:** Several rooms are labeled, including "OPEN" (likely open-plan areas), "KITCHEN", "BATH", "BED", and "LIVING". There are also rooms labeled "STORAGE" and "CLOSET".
- Structural Details:** The plan includes numerous small circles representing columns or structural supports. Diagonal lines indicate structural bracing or load paths.
- Corridors and Entrances:** A central corridor system connects various rooms. Entrances are marked with "X" symbols.
- Room Numbers:** Some rooms are numbered, such as "101", "102", "103", "104", "105", "106", "107", "108", "109", "110", "111", "112", "113", "114", "115", "116", "117", "118", "119", "120", "121", "122", "123", "124", "125", "126", "127", "128", "129", "130", "131", "132", "133", "134", "135", "136", "137", "138", "139", "140", "141", "142", "143", "144", "145", "146", "147", "148", "149", "150", "151", "152", "153", "154", "155", "156", "157", "158", "159", "160", "161", "162", "163", "164", "165", "166", "167", "168", "169", "170", "171", "172", "173", "174", "175", "176", "177", "178", "179", "180", "181", "182", "183", "184", "185", "186", "187", "188", "189", "190", "191", "192", "193", "194", "195", "196", "197", "198", "199", "200".
- Other Features:** The plan includes a "STAIR" (stairs) and a "HALL". There are also areas labeled "PARKING" and "DRIVE".

The drawing is a technical architectural plan, likely a blueprint or a detailed sketch, showing the layout of a building with multiple rooms and structural details.

공 사 명	문학경기장 외 1역 석면함유 건축마감재 해체제거공사	건물 소재지	인천광역시 연수구 예술로 지하 2
출 정 일 시	2017년 3월 17일 (3월 16일 야간)	해 체 면 적	3,896.04 m²
해 체 업체	부천건설(주)	측 정 업체	에코앤티크 주식회사 (T.032.715.5425)